

Manhole Inspection Summary

Manhole # S67M__015MH

Printed On: 9/17/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **67M** Node: **015** Status: **Found**

Insp Date: **1/18/08 12:22 PM**

Incomplete Comments

Crew: **MM, TC**
Inspector: **TomCarter**
Firm: **RJN**

Location Address: **Elliott St.**

Cross Street: **Wellsbach Way**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **NOT ABLE TO INCLUDE BUILDING ADDRESS. ALL STRUCTURES HAVE BEEN RAZED. INSPECTED DAY AFTER RAIN/SNOW EVENT.**

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **36** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **1** nearest .5 ft. Azimuth: **45**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **5** Missing: **0** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S67M__015MH

Printed On: 9/17/2009

Page 2 of 4

Location View



Top View



Manhole Inspection Summary


Manhole # S67M__015MH

Printed On: 9/17/2009

Page 3 of 4

10 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

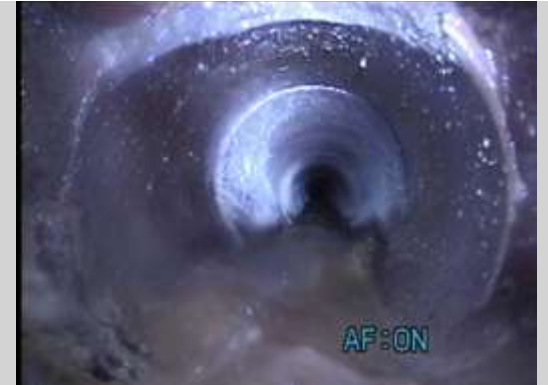

Pipe Height: **9.6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.50** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow

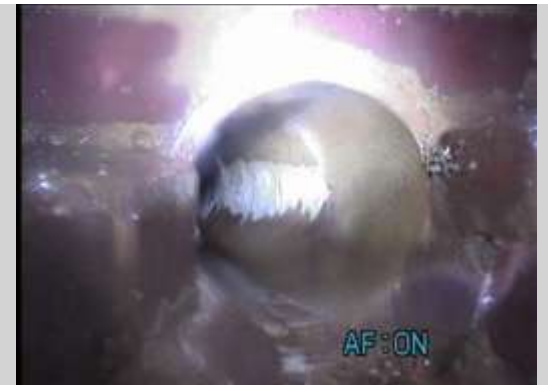

Pipe Height: **6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.08** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S67M__015MH

Printed On: 9/17/2009

Page 4 of 4

10 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



Pipe Height: **9.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.25** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ ~~Sludge~~ ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**


Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock

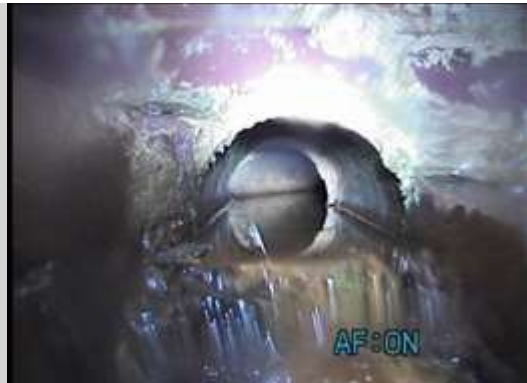

Pipe Height: **6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.25** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ ~~Sludge~~ ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection